



## Technical Service Bulletin

Issued by: Rick Stelzer  
Date: October 15, 2013

Document No: TSB-1004

THIS BULLETIN APPLIES TO:  
Wi-Mgr

---

<b>Issue:</b>	Wi-Mgr not receiving transmissions from 900 MHZ Sensors (Wi-TC9, Wi-TS9, Wi-THS9)
---------------	---

---

<b>Products:</b>	Wi-Mgr with sensors: Wi-TC9 (Counter/Temperature 900MHZ) Wi-TS9 (Temperature 900MHZ) Wi-THS9 (Temperature/Humidity 900MHZ)
------------------	---

---

<b>Fix:</b>	1). Add a 900 Mhz wireless repeater (date code 2012 or earlier) to the system. Or 2). Replace the 900 MHZ radio with a radio that has firmware 3011  Note: Wi-Mgr (Fds-WI) firmware v6.2.9 will identify the installed radio.
-------------	---

---

<b>Units affected:</b>	Wi-Mgr - using 4DI/2RO expansion card and 900 mhz radio firmware 300C or 300D
------------------------	---

---

<b>Symptoms:</b>	Wi-Mgr's without a wireless repeater will not receive 900 MHZ sensor transmissions.
------------------	---

---

<b>Contact:</b>	For additional information: Contact RLE Technical Support 1-970-484-6510 option 2 Email: <a href="mailto:support@rletech.com">support@rletech.com</a>
-----------------	--

---